



SCAPADAS MAGICAS LLC

DOT#:601750



The SMS provides an assessment of a motor carrier's on-road performance and investigation results within the Behavior Analysis and Safety Improvement Categories (BASiCs). Assessments cover 24 months of activity and results are updated monthly. For current Motor Carrier Safety Ratings visit [SAFER](#) and for current operating authority and insurance information visit [Licensing and Insurance](#) (L&I) system.

Vehicle Maintenance

Failure to properly maintain a CMV and/or to properly prevent shifting loads. (FMCSR Parts [392](#), [393](#) and [396](#))

BASIC Overall Status

Exceeds the Intervention Threshold to be prioritized for intervention
(Based on a 24-month record ending January 25, 2013)

On-road Performance Overview



MEASURE: 7.13
PERCENTILE: 74%
(Threshold: 65%)



Relevant Inspections: 25
Total Inspections with Vehicle Maint. Violations: 21
Total Vehicle Maint. Violations: 58

VEHICLE MAINT.

Violation	Description	# Total Violations	# OOS Violations	Violation Weight
393.205(c)	Wheel fasteners loose and/or missing	2	2	2
393.207(a)	Axle positioning parts defective/missing	1	0	7
393.209(e)	Power steering violations	2	0	6
393.28	Improper or no wiring protection as required	1	1	3
393.30	Improper battery installation	1	1	3
393.45(b)(2)	Failing to secure brake hose/tubing against mechanical damage	1	1	4
393.45(d)	Brake connections with leaks/constrictions	1	0	4
393.47(d)	Insufficient brake linings	1	0	4
393.47(e)	Clamp/Roto-Chamber type brake(s) out of adjustment	1	0	4
393.47(g)	Insufficient drum/rotor thickness	1	0	4
393.53(b)	Automatic brake adjuster CMV manufactured on or after 10/20/1994 - air brake	1	0	4
393.60(c)	Damaged or discolored windshield	3	0	1
393.65(c)	Improper securement of fuel tank	1	1	1
393.67	Fuel tank requirement violations	1	1	1
393.75(a)(1)	Tire — ply or belt material exposed	2	2	8
393.75(b)	Tire — front tread depth less than 4/32 of inch	1	0	8
393.75(c)	Tire — other tread depth less than 2/32 of inch	1	0	8
393.78	Windshield wipers inoperative/defective	2	0	1

393.83(a)	Improper exhaust - bus (diesel)	5	0	1
393.83(e)	Improper exhaust discharge (not rear of cab)	1	0	1
393.83(g)	Exhaust leak under truck cab and/or sleeper	1	0	1
393.9	Inoperative required lamps	2	0	2
393.95(a)	No/discharged/unsecured fire extinguisher	2	0	2
393.95(f)	No / insufficient warning devices	4	0	2
393.9H	Inoperative head lamps	1	0	6
393.9T	Inoperative tail lamp	1	0	6
393.9TS	Inoperative turn signal	1	0	6
396.3(a)(1)	Inspection/repair and maintenance parts and accessories	4	0	2
396.3A1B	Brakes (general)	1	0	4
396.5(b)	Oil and/or grease leak	11	1	3

INSPECTIONS WITH VIOLATIONS HISTORY


Report				Vehicle			Measure		
	Inspection Date	#	ST	Plate #	Lic ST	Type	Severity Weight (A)	Time Weight (B)	Time Severity Weight (AxB)
1	10/20/2012	CA3L58000450	CA	8Y24499	MX	Bus	3	3	9
Violation: 396.5(b) Oil and/or grease leak (Non-OOS)							3		
2	10/16/2012	US1354132600	US	8Y82645	CA	Motor Coach	16	3	48
Violation: 393.60(c) Damaged or discolored windshield (Non-OOS)							1		
Violation: 393.83(d) Improper exhaust - bus (diesel) (Non-OOS)							1		
Violation: 393.95(a) No/discharged/unsecured fire extinguisher (Non-OOS)							2		
Violation: 393.95(f) No / insufficient warning devices (Non-OOS)							2		
Violation: 393.30 Improper battery installation (OOS)							5 =3 (viol weight) + 2 (OOS)		
Violation: 396.3(a)(1) Inspection/repair and maintenance parts and accessories (Non-OOS)							2		
Violation: 396.5(b) Oil and/or grease leak (Non-OOS)							3		
3	10/9/2012	US1414130009	US	21775G1	CA	Motor Coach	6	3	18
Violation: 393.83(e) Improper exhaust discharge (not rear of cab) (Non-OOS)							1		
Violation: 396.3(a)(1) Inspection/repair and maintenance parts and accessories (Non-OOS)							2		
Violation: 396.5(b) Oil and/or grease leak (Non-OOS)							3		
4	8/28/2012	US1067120713	US	68798F1	CA	Motor Coach	3	3	9
Violation: 396.5(b) Oil and/or grease leak (Non-OOS)							3		
5	8/11/2012	CA3BF7001378	CA	CP67424	CA	Motor Coach	3	3	9
Violation: 393.67 Fuel tank requirement violations (OOS)							3 =1 (viol weight) + 2 (OOS)		
6	7/11/2012	US1195120220	US	8Y82645	CA	Motor Coach	20	2	40
Violation: 393.207(a) Axle positioning parts defective/missing (Non-OOS)							7		
Violation: 396.5(b) Oil and/or grease leak (Non-OOS)							3		
Violation: 393.83(d) Improper exhaust - bus (diesel) (Non-OOS)							1		
Violation: 393.60(c) Damaged or discolored windshield (Non-OOS)							1		
Violation: 393.53(b) Automatic brake adjuster CMV manufactured on or after 10/20/1994 - air brake (Non-OOS)							4		
Violation: 393.47(e) Clamp/Roto-Chamber type brake(s) out of adjustment (Non-OOS)							4		
7	7/10/2012	US1195120217	US	CP67425	CA	Motor Coach	4	2	8
Violation: 393.83(d) Improper exhaust - bus (diesel) (Non-OOS)							1		
Violation: 396.5(b) Oil and/or grease leak (Non-OOS)							3		
8	7/5/2012	US1375120355	US	CP67425	CA	Motor Coach	20	2	40
Violation: 396.5(b) Oil and/or grease leak (Non-OOS)							3		
Violation: 396.3A1B Brakes (general) (Non-OOS)							4		
Violation: 393.83(d) Improper exhaust - bus (diesel) (Non-OOS)							1		
Violation: 393.75(b) Tire — front tread depth less than 4/32 of inch (Non-OOS)							8		
Violation: 393.47(g) Insufficient drum/rotor thickness (Non-OOS)							4		
9	5/25/2012	CA3JX1000889	CA	8Y82645	CA	Motor Coach	4	2	8
Violation: 393.205(c) Wheel fasteners loose and/or missing (OOS)							4 =2 (viol weight) + 2 (OOS)		
10	5/25/2012	CA3L4U000028	CA	CP67425	CA	Bus	6	2	12
Violation: 393.205(c) Wheel fasteners loose and/or missing (OOS)							4 =2 (viol weight) + 2 (OOS)		
Violation: 396.3(a)(1) Inspection/repair and maintenance parts and accessories (Non-OOS)							2		
11	4/6/2012	CA303M002624	CA	CP67424	CA	Bus	21	2	42
Violation: 393.75(c) Tire — other tread depth less than 2/32 of inch (Non-OOS)							8		
Violation: 393.75(a)(1) Tire — ply or belt material exposed (OOS)							10 =8 (viol weight) + 2 (OOS)		
Violation: 393.65(c) Improper securement of fuel tank (OOS)							3 =1 (viol weight) + 2 (OOS)		
12	12/6/2011	US1383120031	US	CP67424	CA	Motor Coach	20	1	20
Violation: 393.9H Inoperative head lamps (Non-OOS)							6		
Violation: 393.28 Improper or no wiring protection as required (OOS)							5 =3 (viol weight) + 2 (OOS)		
Violation: 393.209(e) Power steering violations (Non-OOS)							6		
Violation: 396.5(b) Oil and/or grease leak (Non-OOS)							3		
13	11/9/2011	CA3BGP000849	CA	33018A1	CA	Bus	2	1	2

Violation: 396.3(a)(1) Inspection/repair and maintenance parts and accessories (Non-OOS)							2		
14	11/9/2011	CA3BGP000850	CA	CP67425	CA	Bus	6	1	6
Violation: 393.78 Windshield wipers inoperative/defective (Non-OOS)							1		
Violation: 393.9 Inoperative required lamps (Non-OOS)							2		
Violation: 396.5(b) Oil and/or grease leak (Non-OOS)							3		
15	11/9/2011	CA3BGP000851	CA	8Y82645	CA	Bus	4	1	4
Violation: 393.9 Inoperative required lamps (Non-OOS)							2		
Violation: 393.95(f) No / insufficient warning devices (Non-OOS)							2		
16	10/12/2011	US0963100077	US	CP67424	CA	Motor Coach	4	1	4
Violation: 393.83(d) Improper exhaust - bus (diesel) (Non-OOS)							1		
Violation: 396.5(b) Oil and/or grease leak (Non-OOS)							3		
17	10/11/2011	US1062110126	US	8Y82645	CA	Motor Coach	6	1	6
Violation: 393.95(f) No / insufficient warning devices (Non-OOS)							2		
Violation: 393.47(d) Insufficient brake linings (Non-OOS)							4		
18	6/21/2011	US1067110600	US	CP67424	CA	Motor Coach	30***	1	30
Violation: 393.45(d) Brake connections with leaks/constrictions (Non-OOS)							4		
Violation: 393.78 Windshield wipers inoperative/defective (Non-OOS)							1		
Violation: 393.45(b)(2) Failing to secure brake hose/tubing against mechanical damage (OOS)							6	=4 (viol weight) + 2 (OOS)	
Violation: 393.209(e) Power steering violations (Non-OOS)							6		
Violation: 393.83(g) Exhaust leak under truck cab and/or sleeper (Non-OOS)							1		
Violation: 396.5(b) Oil and/or grease leak (OOS)							5	=3 (viol weight) + 2 (OOS)	
Violation: 393.9TS Inoperative turn signal (Non-OOS)							6		
Violation: 393.95(a) No/discharged/unsecured fire extinguisher (Non-OOS)							2		
Violation: 393.9T Inoperative tail lamp (Non-OOS)							6		
19	4/17/2011	CA39WK000119	CA	CP67425	CA	Bus	10	1	10
Violation: 393.75(a)(1) Tire — ply or belt material exposed (OOS)							10	=8 (viol weight) + 2 (OOS)	
20	3/13/2011	CA0005107888	CA	33018A1	CA	Motor Coach	1	1	1
Violation: 393.60(c) Damaged or discolored windshield (Non-OOS)							1		
21	2/9/2011	US1375110129	US	7K21176	CA	Passenger Van	2	1	2
Violation: 393.95(f) No / insufficient warning devices (Non-OOS)							2		

Investigation Results Overview



No serious violation(s) discovered

Certain violations found during an investigation can result in a  for a BASIC. The status remains for 12 months following the investigation.


SERIOUS VIOLATIONS FROM INVESTIGATIONS

There are no Serious Violations to display


Use this page to view graphs of various aspects of your safety performance.

Trends View

Relevant Inspections vs Inspections with Violations

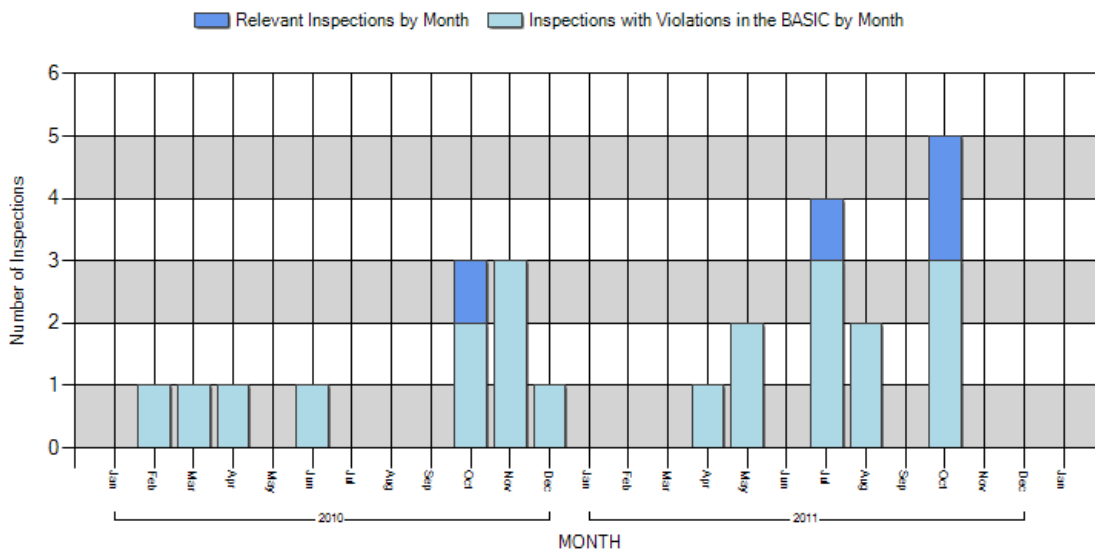


Safety Event Group Measure vs Percentile

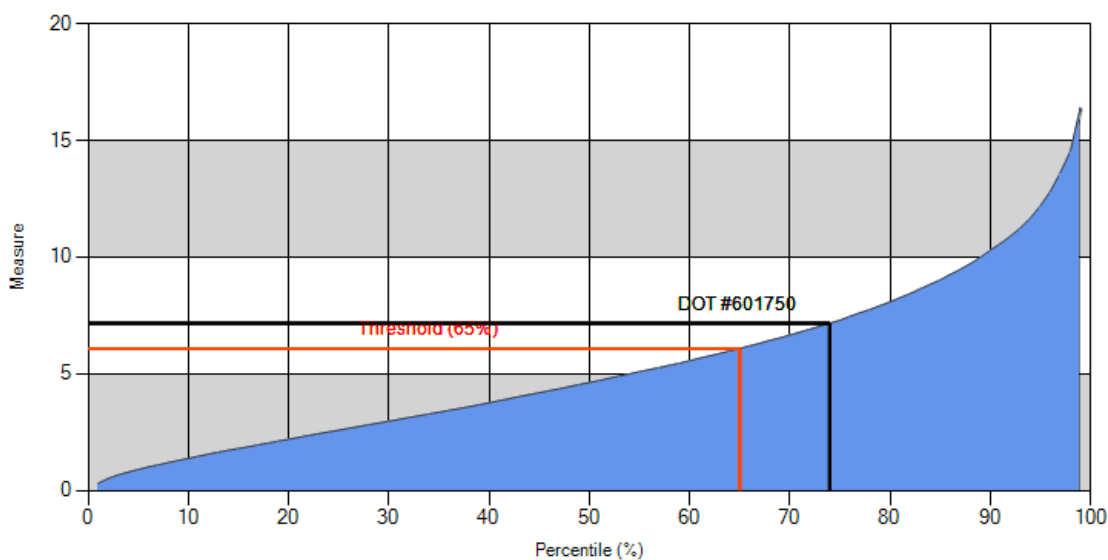

$$\text{Measure} = \frac{\text{Sum of Time Severity Weight (AxB)}}{\text{Sum of Time Weight (B)}} = \frac{328}{46} = 7.13 \Rightarrow 74\%$$

Trends of Vehicle Maintenance Measure based on SMS 3.0

The trends area shows a Motor Carrier's safety performance over time using a consistent methodology, SMS 3.0

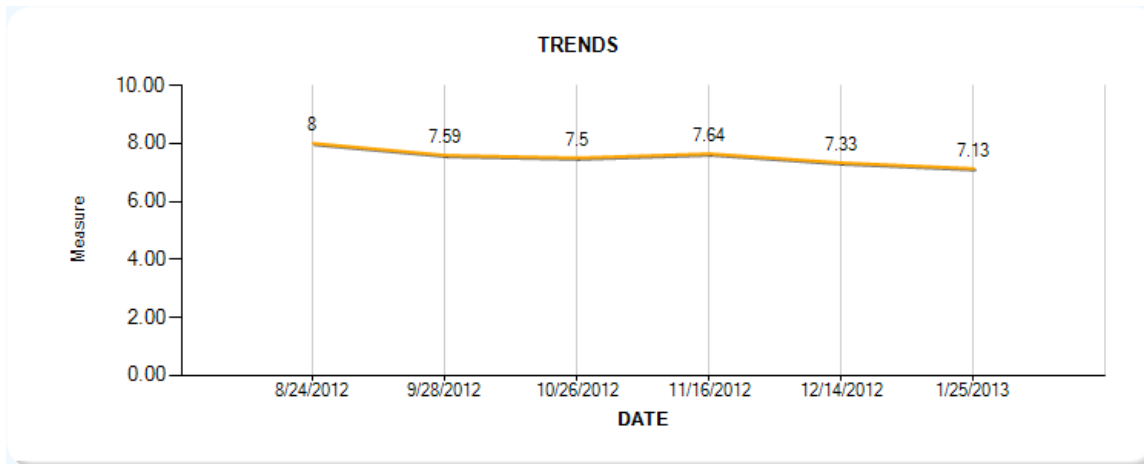

Trends Detail	08/24/2012	09/28/2012	10/26/2012	11/16/2012	12/14/2012	01/25/2013
Percentage:	78.6%	76.4%	75.9%	77%	75.2%	74%
Measure:	8.00	7.59	7.50	7.64	7.33	7.13
Safety Event Grouping:	○●○○○ 21-100	○●○○○ 21-100	○●○○○ 21-100	○●○○○ 21-100	○●○○○ 21-100	○●○○○ 21-100
Relevant Inspections:	30	29	30	28	26	25
Total Inspections with Vehicle Maint. Violations:	25	24	25	23	22	21
Total Vehicle Maint. Violations:	74	66	71	63	59	58



[Feedback](#) | [Privacy Policy](#) | [USA.gov](#) | [Freedom of Information Act \(FOIA\)](#) | [Accessibility](#) | [OIG Hotline](#) | [Web Policies and Important Links](#) | [Site Map](#) | [Plug-ins](#)

Federal Motor Carrier Safety Administration
 1200 New Jersey Avenue SE, Washington, DC 20590 • 1-800-832-5660 • TTY: 1-800-877-8339 • [Field Office Contacts](#)